


HIGH POWER **LED HEADLIGHT**

Item Numbers: 35879, 35880, 35881, 35882

Connect Plugo to Original OE Wire Harness

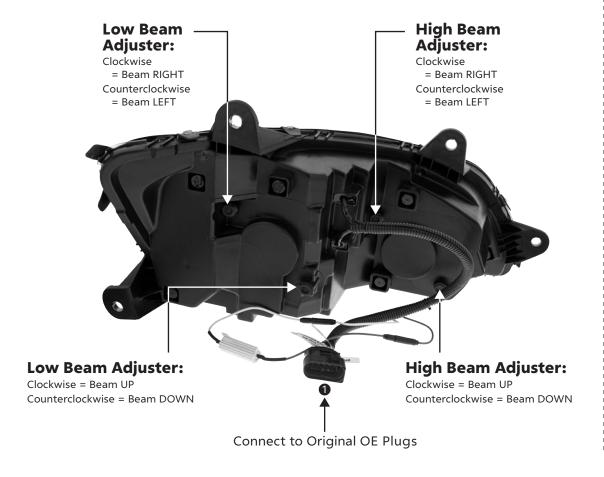


Normal Fogging / Condensation


This bulletin provides information regarding headlights that may experience fogging or condensation inside of the headlamp assembly. A drop in air temperature may cause condensation to form on the inside of a cool headlamp lens. Generally, fogging is considered normal and can be eliminated by turning on the headlamp with the engine running for several minutes. In most cases, operating the vehicle in normal driving condition will clear the headlamp fogging. Headlamp assembly replacement **WILL NOT** be necessary in most cases.

Note

- If any of the following conditions occur, please consult with a professional mechanic to determine the water source:
 - If condensation/fogging fails to dissipate after operating the headlight with the engine running for 30 minutes
 - O If water pooled inside the headlamp
- A high pressure washer may also cause water to be forced into the headlamp assembly.

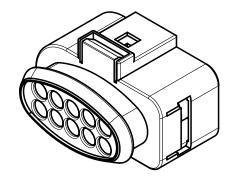

SCALE 1:1

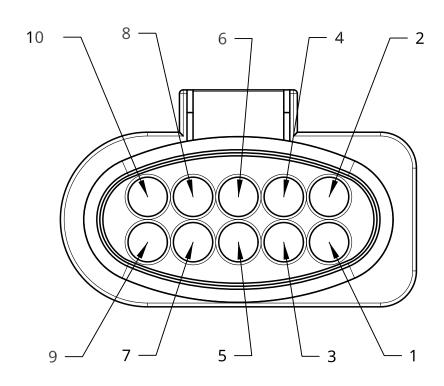

В

NOTE: VIEW FROM BACK OF VEHICLE'S EXISTING
HEADLIGHT WIRING HARNESS MALE CONNECTOR

Pin #	T680	T660
1	HL Hi	DRL/Sidemarker
2	Signal	Not Use
3	DRL	Signal
4	Sidemarker	Signal/DRL (-)
5	Not Use	HL Low
6	Signal/DRL/SM (-)	HL (-)
7	HL Low	HL Hi
8	HL (-)	Not Use
9	Not Use	Not Use
10	Not Use	Not Use

T680 & T660 Headlight Connector Pinout				
A DWG NO.	05072020	REV.		
SCALE 2:1	WEIGHT SHEE	[™] 1 of 1		

2

•

Α

В